

Yaris

Swivel seat
Installation Instructions



Model Year: 2006

Body type Yaris

Part Number: LHD 5DR 08926-52870

3DR 08926-52868 RHD5DR 08926-52869

00020 02000

3DR 08926-52867

Weight: 44 kg

Installation Time: 60 minutes

Manual reference number AIM 000720-0


Take off the Box







CAUTION!! ----

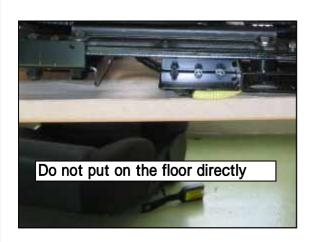



Note: No side air bag systems Mobility seat

All pictures mentioned on this I/M are for LHD vehicle.

Check all parts before installation.

Parts List for Yaris (LHD) France Only								
Part Number	Parts	Yarıs (LHD) France Only Part Number Parts						
A 1 ×	Faits	2 ×						
5DR: C7002-1410 3DR: C7002-1400	44	74596-D1020 Siège tournant installé. Pas d'Airbeg latéral coté passager.						
B 1 ×		1 ×						
82711-1E360	installed	C8235-D1050 44						
C 9 ×	\$14 × L27.5	1 ×						
90119-10578		01999-D1084						
	39 40 42 43	1 × English						
	47 48 49	01999-D1085						
D 1 ×		[Distance No.]						
90119-10579	S14 × L55 46	Picture No.						
1 ×	38							
C7120-D1680	38							
7 1 ×	Section 1							
C7120-D1660	41							
G 1 ×								
C8218-D1040	51							
1 ×								
74553-D1050	54							
1 ×	Attention Ne pas poser ses pieds, ses mains ni un quelconque objet à cet endroit. Cela pourrait occasionner une blessure ou autre accident.							
74552-D1060	55							
J 2 ×								
74551-D1020	59 CRS defends							

Parts List for Yaris (RHD) UK Only									
Part Number	Parts	Part Number	Parts						
A 1 × 5DR:C7002-D1380 3DR:C7002-D1390	44	74596-D1010	MARNING SRS passenger side airbag not available. Mobility seat installed 58						
B 1 × 82711-1E360	installed	C8235-D1050	44						
90119-10578	S14 × L27.5	M 1 × 75271-D1020 2	26						
	39 40 42 43 47 48 49	715170D1070 1	17						
D 1 ×		O 1 ×	29						
E 1 × C7120-D1670	S14 × L55 46	P 1 x	30						
T 1 × C7120-D1650	41	Q 2 × 91511-60610 2	S10×L10						
G 1 × C8218-D1040	51	1 × 01999-D1086	Strethard Beast English						
1 × 74553-D1020	54		Picture No.						
1 × 74552-D1050	Attention Ne pas poarr ses pieds, ses mains ni un quelconque objet à cet endroit. Cela pourrait occasionner une blessure ou autre accident. 55								
J 2 × 74551-D1010	56 Cit's not allowed Mobility seat installed								


Tools













Torque Wrench is also required

PROTECT COVER



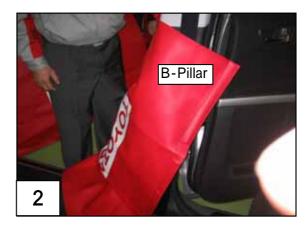



CAUTION!!

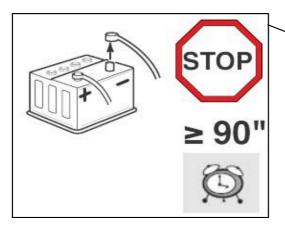





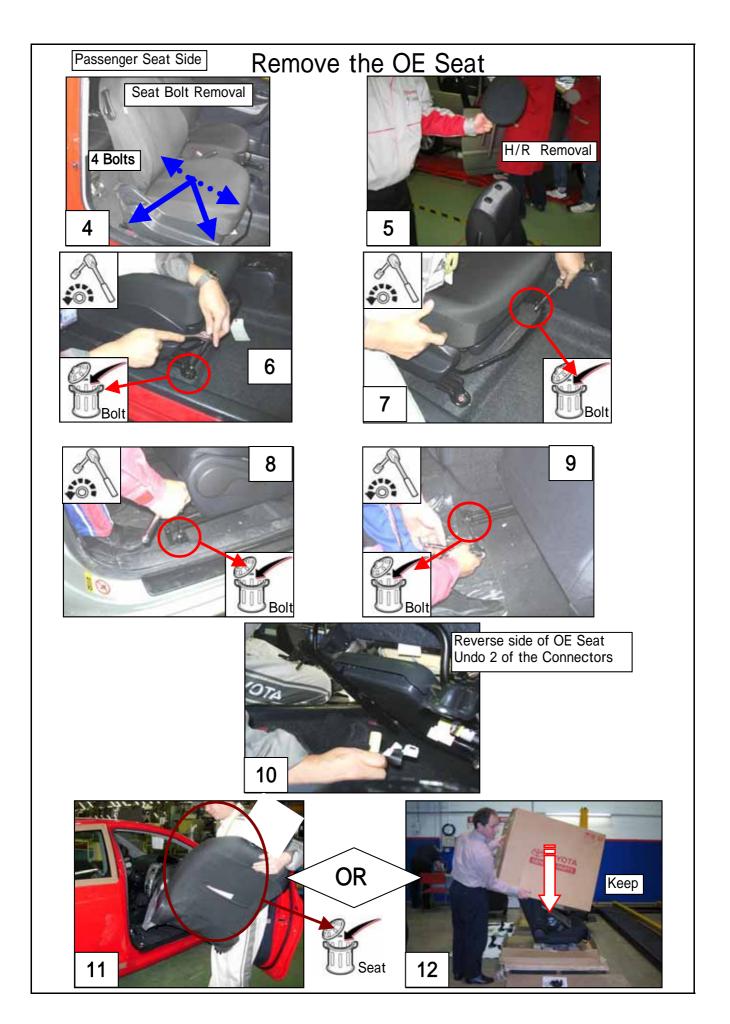

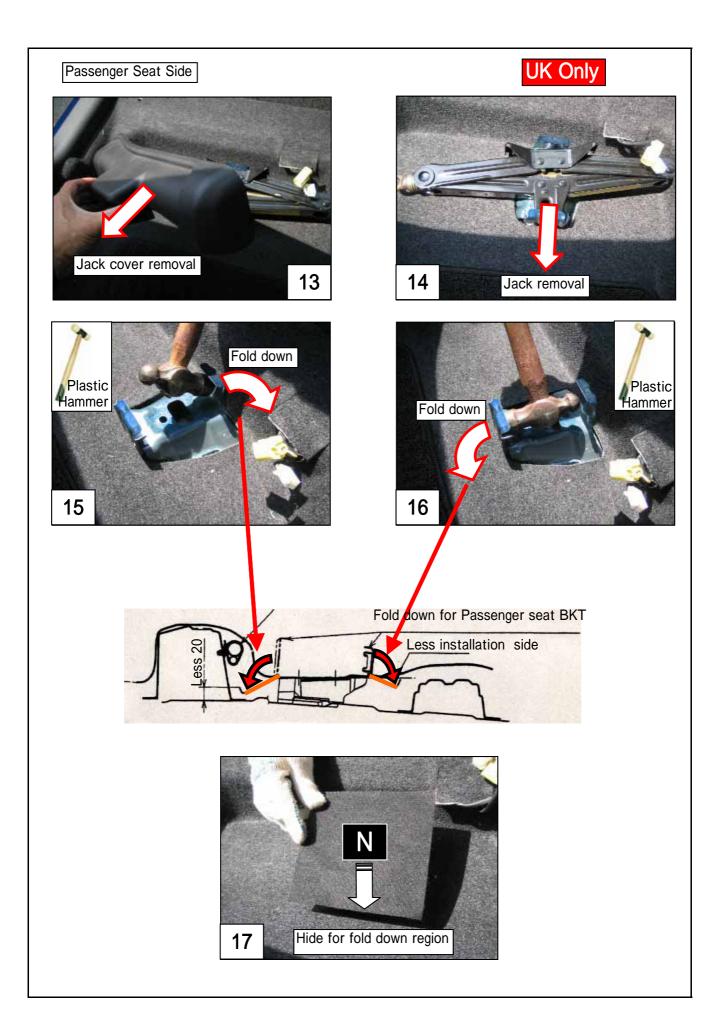

Remove be Driver Seat




Driver Seat Side










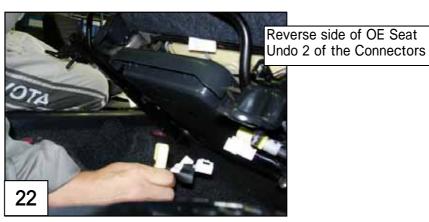






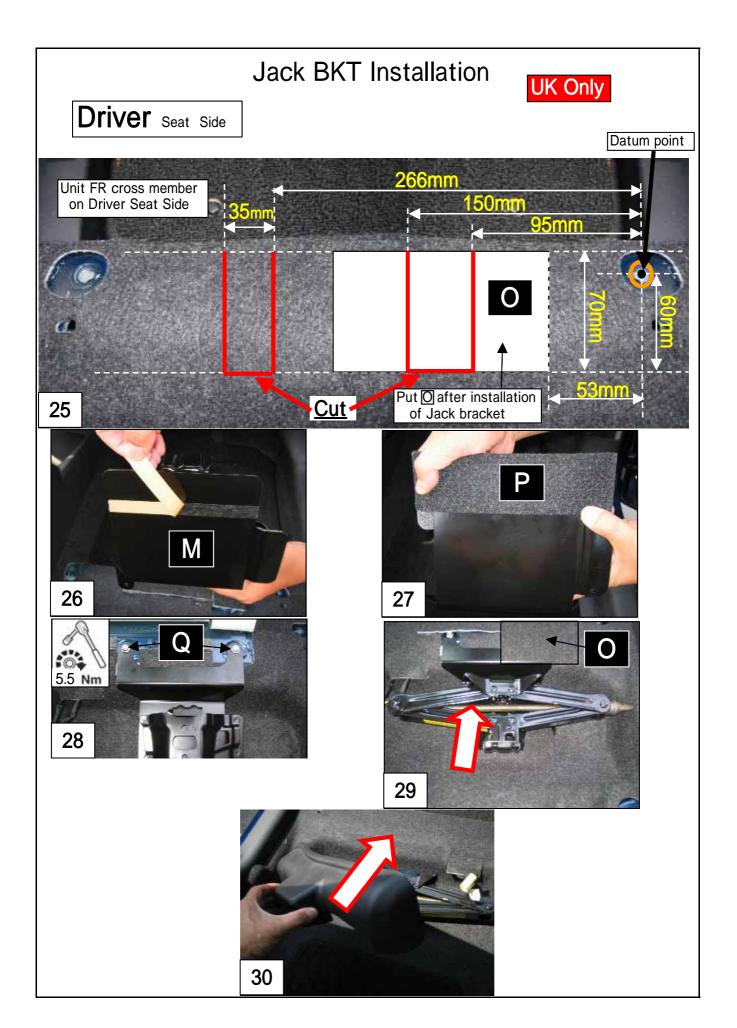

Completely Recovered for Driver Seat UK Only





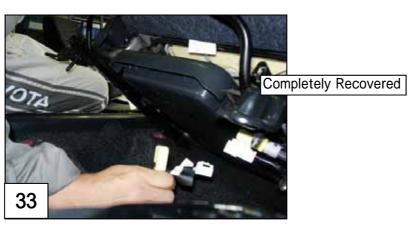













Swivel Seat Installation


Passenger Seat Side

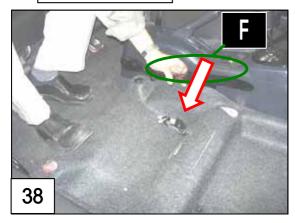


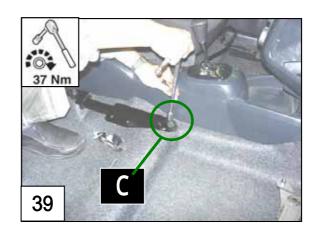


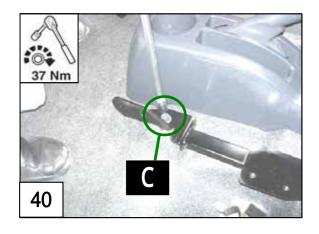

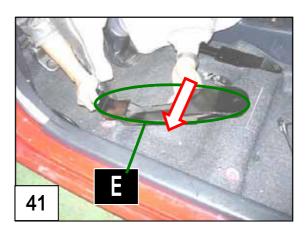

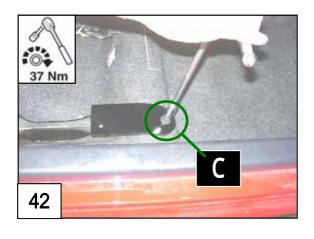


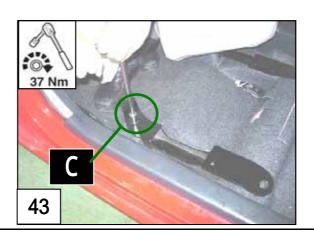


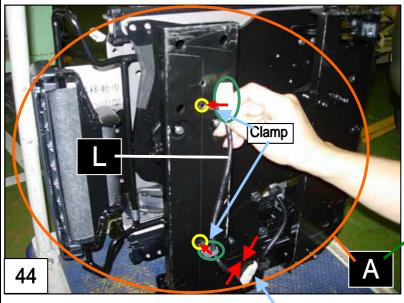






Connect

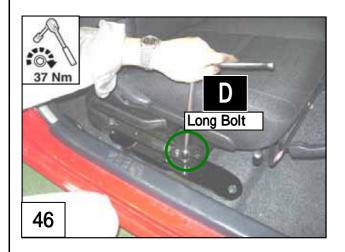


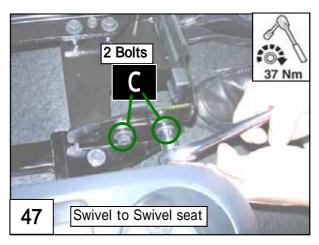


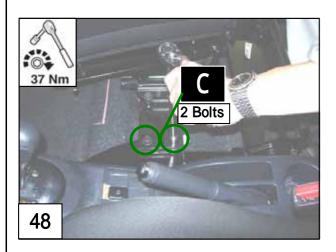

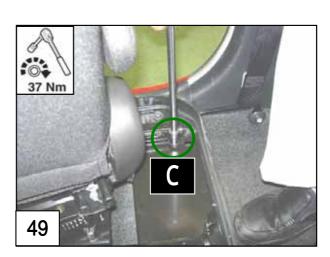


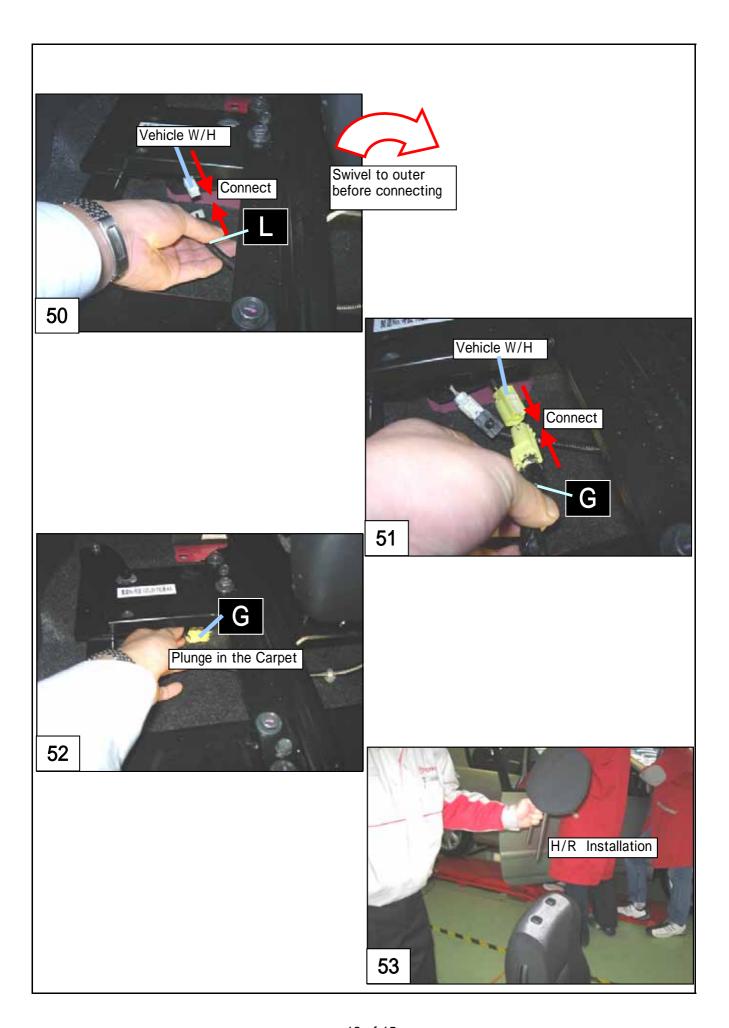

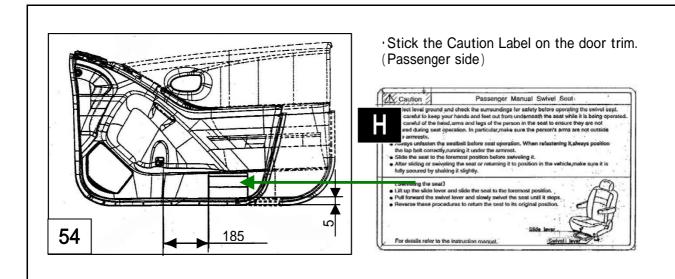

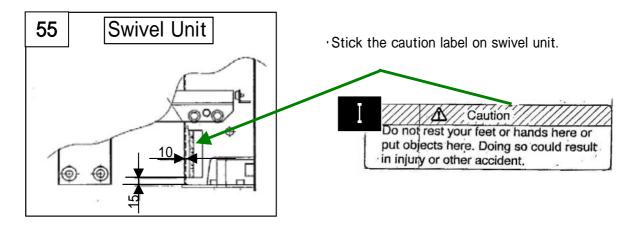

Please make sure the Unit swivels properly after finishing installation.

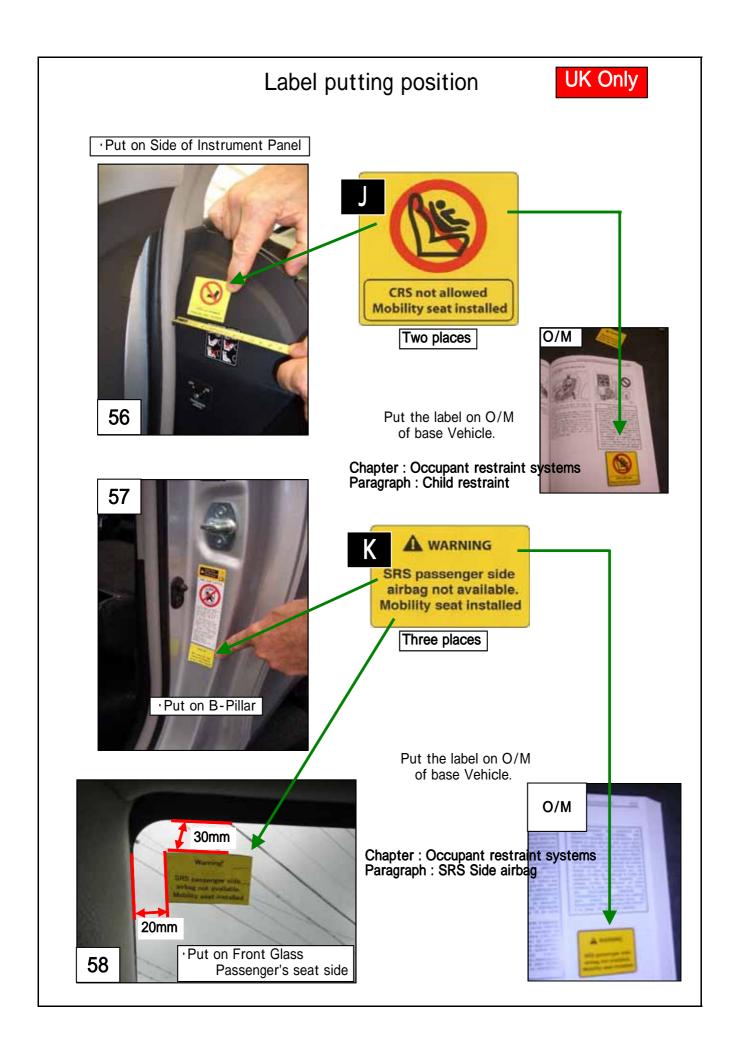

Label putting position

France Only





Put the label on O/M of base Vehicle.

Dispositif de retenue des occupants Sieges enfants







Put the label on O/M of base Vehicle.

Dispositif de retenue des occupants SRS Airbag lateraux



Bourgetlaan 60 B-1140 Brussels

Installation	check	ksheet
--------------	-------	--------

Yaris P9													
	Mobility project : swivel seats												
Opera	ator:								Da	ate:			
VIN:													
Before	e installation								_			Su	pervisor check:
	Box content OK Serial number Lift										7		

During installation

*	VSC ECU and sensor do not interfer with swivel seat					
	Earth connection firmly fitted					
	Foam around connectors					
	B+ terminal in fuse box has proper connection					
Seat / headrest	Don't squeeze wires					
	Don't damage connectors during handling					
	Front seat bolts on torque 37Nm					

After installation

	All parts installed according to manual	
*	SRS warning light comes on when turning key to 'ON' position SRS warning light goes off after approximately 6 seconds	
	Passenger detection light working	
	Warning lights	
	Seat heaters working	
	Tune, seek radio	
	Volume up and down (from steering wheel)	
Dashboard	Correct position comes on the screen automatically (after satellite reception, with full map navi)	
Dash	Console is well aligned with dashboard, no gaps	
	Cigarette lighter operating	
	Cigarette lighter illumination	
	Audio illumination	
	Electric Mirror working	
	No traces of wiring	
	No scratches on dash board	
	VSC signal goes off	

	Seat (rail) covers well fitted	L	R						
Front seats	Wiring under seats leaves enough room for movements, no obstruction when moving forward/backward, up/down. No interference with swivel operation	L	R						
ш	Wiring under seats strapped to original wiring								
	Inspect no damage on the covers / fabric	L	R						
de	Plastic covers are well fitted ?								
, si	Stickers well fitted ?								
Bacl	Stickers well fitted ?								
System (seat operation)	Arm and foot rest working ok ?								
	Front rear movement is OK ?								
(se	Swivel movement is OK ?								
Ë	Force for operating swivel lever is OK ?								
yste									
ώ.									
-	No NVH while driving ?								
General									
Ge									

Version date: 15/09/2006